


4A132M6-023-001

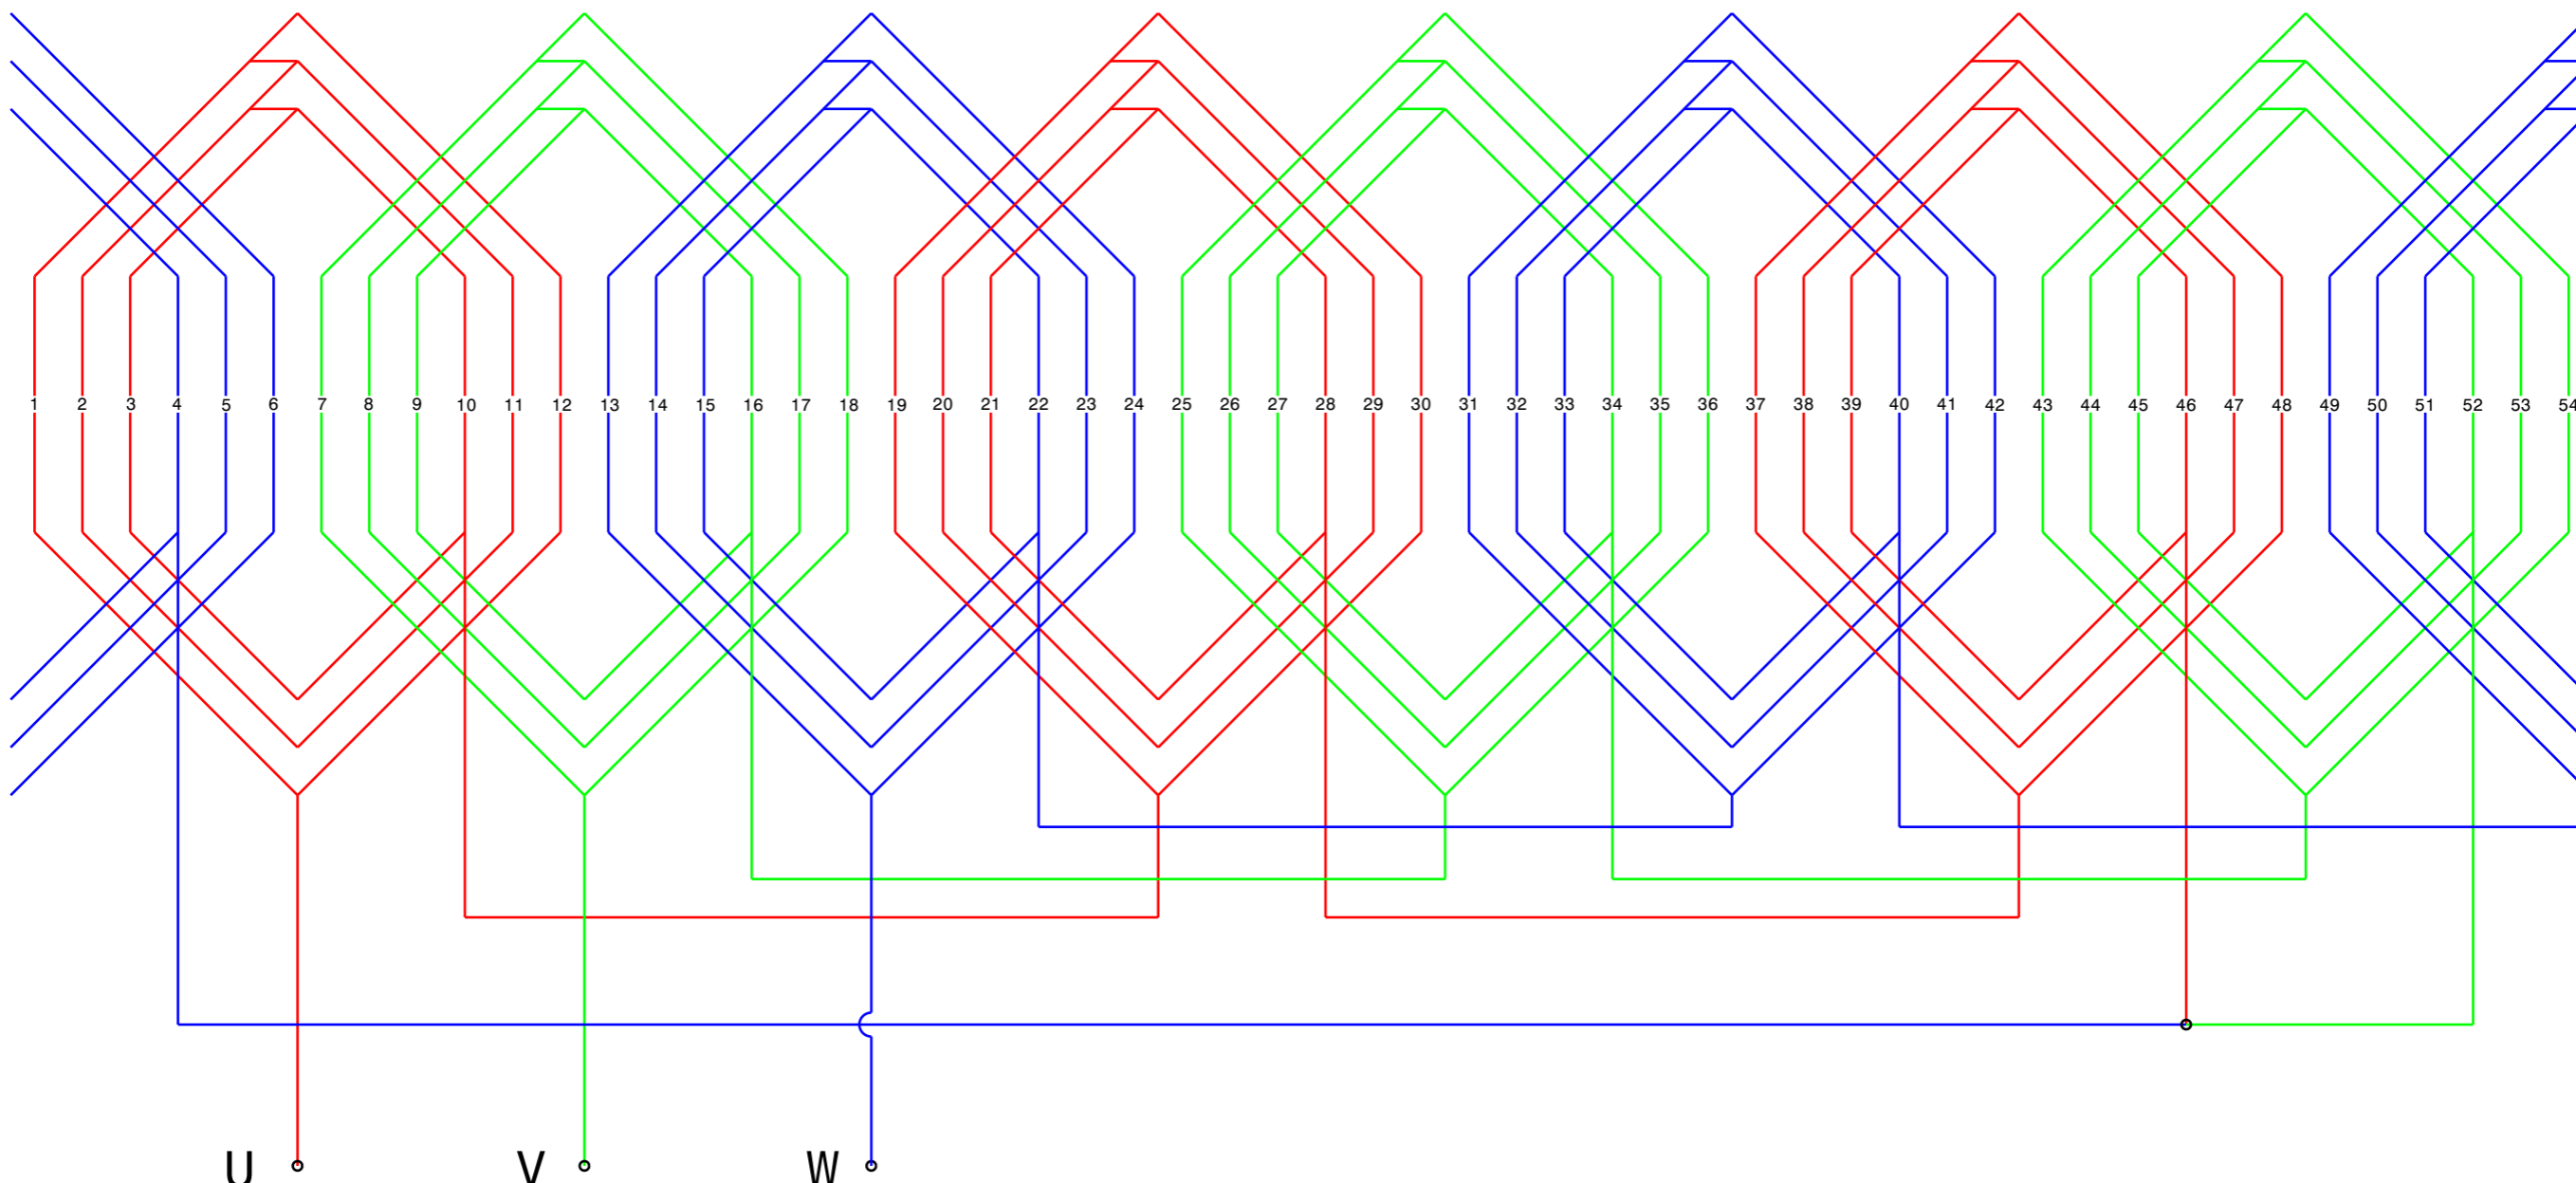

Use
Num. 3
B
A

Sign. & date
Num. 2
Num. 1
Sign. & date
Num.
A

No. of winding layers	1
No. of parallel wires	2
No. of parallel branches	1
No. of turns per coil	135
Winding pitch in slots	9
Wire diameter, mm	1.25
Phase resistance @ 20°C, Ohm	0.646

If not specified, tolerance of +/-0.1mm must be used.
Sharp edges must be removed.
This drawing cannot be reproduced or communicated without written agreement of Dr. A.Pulnikov.

				4A132M6-023-001			
				Stator winding diagram			
Mod	Sh.	N. doc	Sign.				Date
Design		Pulnikov		17/06/2020		-	1:1
Checked		Schmidt			Sheet 1		Sheets 1
Control							
Depart.							
Control							
Appr.		Pulnikov					
				-			Pulnikov EC